



GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, NEW DELHI-110001

No. F.6/DFS/MS/School/2025/SZ/ 276

Dated: 30 / 05 / 2025

FIRE SAFETY CERTIFICATE

Certified that the building of “**School for Physically Challenged**” located at PSP Sec-13 (Near Iskcon Temple), Dwarka, New Delhi-110078, comprised of Basement, Stilt/Gd. + 03 Upper Floors, owned/occupied by Chandra Bhushan Singh Memorial Mahila, Bal Evam Shravan Viklang Siksha Evam Punarvas Sansthan, was issued Fire Safety Certificate by this department vide letter No. F.6/DFS/MS/SZ/2022/73 dated 17/02/2022. The premises was re-inspected by the officer concerned of this department on dated 15/05/2025 in the presence of Sh. Hitesh Singh (Ex. Manager) and found that the said premises have deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the premises/building is fit for occupancy class “**Educational Group B**” with effect from 30 / 05 / 2025 for a period of **three years** in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 30 / 05 / 2025 at New Delhi by

(ATUL GARG)
DIRECTOR
Ph. 011-23414000

Copy to: -

1. The President, Chandra Bhushan Singh Memorial Mahila, Bal Evam Shravan Viklang Siksha Evam Punarvas Sansthan at PSP Sector-13 (Near Iskcon Temple), Dwarka, New Delhi-110078
2. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi-110054.

Conditions for the validity of Fire Safety Certificate:

1. **Basement floor shall not be used for school activity as per undertaking dated 15/05/2025. Else, FSC shall stand withdrawn.**
2. All the means of escape/entry/exit shall be kept free from any obstruction.
3. All the fire safety arrangement provided therein shall be maintained in good working conditions at all time as seen during inspection. Any loss of life property due to non-functional fire safety measures shall be at the responsibility of the management.
4. All the staff members must know the correct method of operation of fire-fighting system.
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or alteration (Clause 1.4.3 of UBBL-2016), if any.
6. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form ‘J’ [sub rule (1) of rule 37] along with a copy of this Certificate, prior to its expiry.
7. The owner/occupier shall submit a declaration every year in form “K” provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in

INSPECTION REPORT

1.	Name & address of the building	"School for Physically Challenged" Chandra Bhushan Singh Memorial Mahila, Bal Evam Shravan Viklang Siksha Evam Punarvas Sansthan at PSP Sector-13 (Near Iskcon Temple) Dwarka, New Delhi-110078		
2.	Type of Occupancy	Educational Building		
3.	Building Comprised of	Basement, Stilt + three upper floors Basement & Stilt/Corr. Parking, 1 st & 2 nd Floor - Class Rooms and 3 rd Floor - Vacant		
4.	Type of Case	Renewal		
5.	Details of previous NOC No.	F.6/DFS/MS/SZ/2022/73 dated 17/02/2022		
6.	Fire Safety directives Letter No.	F6/DFS/MS/BP/2015/241 dated 26/08/2015		
7.	Date of inspection	15/05/2025		
8.	Name of the Inspecting Officer	DO (SW) & ADO (DWK)		
9.	Name and designation of Officer from the building side	Sh. Hitesh Singh (Ex. Manager)		
10.	Year of Construction	2015		
11.	Applicant's letter No.	Through Email dated 07/05/2025		
S. No.	Minimum standards on fire prevention and fire safety U/R 33	Requirements As per N/9-11	Provided at site	Remarks MR/NMR
1.	Access of building			
	• Road width	12 mtr	30 mtr	MR
	• Gate width	4.5 mtr	Provided	MR
	• Width of internal road	N/A	N/A	N/A
2.	Number, width, Type & Arrangements of exits			
	a. Number of staircases			
	• Upper floors	02 Nos.	Provided	MR
	• Basements	1no. & 2 Ramp	Provided	MR
	b. Width of staircases			
	• Upper floors	1.5 mtr	1.54m & 1.67m	MR
	• Basements	1.5 mtr	1.69m & ramp 3.40m	MR
	c. Protection of exits			
	• Fire check door	Required	Provided in basement	MR
	• Pressurization	N/A	N/A	N/A
	d. No of continuous staircase to terrace	01 No	Provided	MR
	e. Width of Corridor	1.5m	2.55m	MR
	f. Door Size	1.0m	1.2m (Including frame)	MR
3.	Compartmentation			
	• Fire check door	Required	Provided in basement	MR
	• Sealing of electrical shafts	Required	Provided	MR
	• Fire Rating of shaft door	N/A	N/A	N/A
	• Water Curtain	N/A	N/A	N/A
	• Fire Dampers	N/A	N/A	N/A
4.	Smoke Managements System			
	• Basements	Required	Provided	MR
	• Upper floors	12 ACPH	Natural ventilation	MR
5.	Fire Extinguishers			
	• Total numbers	ISI marked	10nos	MR
	• Types		ABC & CO ₂	MR
	• ISI marking		ISI Marked	MR
6.	First-Aid Hose Reels			
	• Total numbers on each floor	Hose-reels	02 Nos	MR
	• Length of hose reel hose		30m	MR
	• Nozzle diameter		5mm	MR

N-17

7.	Automatic fire detection and alarming system			
	• Type of detector	N/A	N/A	N/A
	• Location of Main Panel	N/A	N/A	N/A
	• Location of Repeater Panel	N/A	N/A	N/A
	• Alternate source of power	N/A	N/A	N/A
	• Hooters' Location	N/A	N/A	N/A
8.	MOEFA	N/A	N/A	N/A
9.	Public Address System	N/A	N/A	N/A
10.	Automatic Sprinkler System			
	• Basements	Required	Provided	MR
	• Upper Floor	N/A	N/A	N/A
	• Sprinkler above false ceiling	N/A	N/A	N/A
11.	Internal Hydrants			
	• Size of riser/down- comer	N/A	N/A	N/A
	• Number of hydrants per floor	N/A	N/A	N/A
	• Hose Box	N/A	N/A	N/A
12.	Yard Hydrants			
	• Total number of hydrants	N/A	N/A	N/A
	• Hose Box	N/A	N/A	N/A
13.	Pumping Arrangements			
	• Ground Level			
	➤ Discharge of main pump	2280 LPM	Provided	MR
	➤ Head of main pump	70m	Provided	MR
	➤ Number of main pumps	One	Provided	MR
	➤ Jockey pump out put	180 LPM	Provided	MR
	➤ Jockey pump head	70m	Provided	MR
	➤ Standby Pump out put	2280 LPM	Provided	MR
	➤ Standby Pump Head	70m	Provided	MR
	➤ Auto Staring/Manual stopping	Required	Provided	MR
	➤ Pump House Access	Required	Provided	MR
	• Terrace level			
	➤ Discharge of pump	900 LPM	Provided	MR
	➤ Head of the pump	40 mtr	Provided	MR
	➤ Power supply	Required	Provided	MR
	➤ Auto starting of pump	Required	Provided	MR
14.	Captive water storage for firefighting			
	• Underground tank capacity	1,00,000 Ltr	Provided	MR
	➤ Draw of connection	N/A	N/A	N/A
	➤ Fire service inlet	N/A	Provided	N/A
	➤ Access to tank	N/A	N/A	N/A
	• Overhead Tank capacity	15,000 Ltr	15,000 Ltr	MR
15.	Exit Signage	Required	Provided	MR
16.	Provision of Lifts			
	➤ Pressurization of Lift Shaft	N/A	N/A	N/A
	➤ Pressurization of lift lobby	N/A	N/A	N/A
	➤ Communication in lift Car	Required	Provided	MR
	➤ Fireman's Grounding Switch	Required	Provided	MR
	➤ Lift Signage	Required	Provided	MR
17.	Standby Power Supply	Required	Provided (DG Set)	MR
18.	Refuge Area			
	➤ Total area	N/A	N/A	N/A
	➤ Location	N/A	N/A	N/A

SL

L

N-18

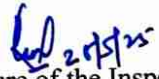
19.	Fire Control Room			
	➤ Detector system panel	N/A	N/A	N/A
	➤ Flow Switch Panel	N/A	N/A	N/A
	➤ PA System Panel	N/A	N/A	N/A
	➤ Battery backup	N/A	N/A	N/A
	➤ Building Floor Plans	N/A	N/A	N/A
20.	Special Fire Protection Systems for Protection of Special Risks, if any;	CO2 fire extinguisher provided near electric panel		MR

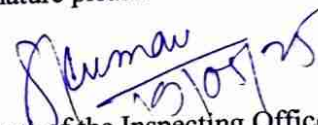
Note: Sh. Hitesh Singh, Executive Manager, Chandra Bhushan Singh Memorial Mahila, Bal Evam Shravan Viklang Siksha Evam Punarvas Sansthan has submitted an undertaking dated 15/05/2025 regarding not to use basement for school activity or other purpose other than parking and storage.

The fire protection systems provided in the building were test checked and found functional at the time of inspection. The shortcomings issued by this department vide letter No. F.6/DFS/MS/School/2025/SZ/184 dated 22/04/2025 found rectified.




Keeping in view of the deemed compliance of the minimum standards on fire prevention and fire safety required under the rules, the fire safety certificate issued vide letter No. F-6/DFS/MS/2022/SZ/2022/73 dated 17/02/2022, renewal under rule 37 of the Delhi Fire Service Rules, 2010 is recommended.

Accordingly, DFA is put up for perusal/approval & signature please.


Signature of the Inspecting Officer
Name: Rajender Atwal
Designation: DO (SW)



Signature of the Inspecting Officer
Name: Santosh Kumar
Designation: ADO (DWK)

CFO(HQ)


22/5/2025

Director

22/5/2025
Rajender Atwal

Sir,

F.T letter is put up for your sig. pl


Director
22/5/2025


Santosh Kumar
22/5/2025