

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE

NEW DELHI-110 001.

No. F.6/DFS/MS/School/2026/SZ / 82

Dated: 29/06/2026

FIRE SAFETY CERTIFICATE

Certified that the ITBP Public School located at Sector- 16B, Dwarka, New Delhi- 110078, comprised of basement (parking), ground floor plus 04 upper floors, was issued Fire Safety Certificate by this department vide letter No. F.6/DFS/MS/School/2022/SZ/381 dated 06.04.2022. The school building was re- inspected by the officer concerned of this department on dated 09.06.2026 in the presence of Sh. Surjan Singh, and found that the school building have complied the fire prevention and fire safety requirements in accordance with Rule 33 of the Delhi Fire Service Rules, 2010 and that the building/premises (**Basement, ground plus 04 upper floors**) is fit for occupancy class "Educational Building" w.e.f. 29/06/2026 for a period of three years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule-38 of the Delhi Fire Service Rules, 2010 printed as below.

Issued on 29/06/2026 at New Delhi by.


(S.K.Dua)
Chief Fire Officer
West Zone
9cy.

Copy to: -

1. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi-110054.
2. The Principal, ITBP Public School located at Sector- 16B, Dwarka, New Delhi- 110078.
3. The Executive Engineer (Bldg.), MCD, Civic Centre, New Delhi.

: - for information regarding use of basement.

Conditions for the validity of fire safety certificate: -

1. All the fire safety arrangements provided therein shall be maintained in good working condition at all times.
2. The means of escape shall be kept unlocked and unobstructed for unhindered evacuation of occupants in case of emergency.
3. Any loss of life or property due to non-functional fire safety measures shall be at the risk and responsibility of the management.
4. The trained staff should be available round the clock.
5. Any deviations w.r.t. construction shall be verified by the concerned building sanctioning agency.
6. The certificate may not be treated in any case for the regularization of the unauthorized construction, if any.
7. Presently basement is used only for parking purpose.
8. The owner/occupier shall submit a declaration every year in the form 'K' provided in the first schedule of Delhi Fire Service Rules 2010, form is available on www.dfs.delhigovt.nic.in.
9. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in the Form

INSPECTION REPORT

1. Name & address of the building : ITBP Public School at Sector- 16B, Dwarka, New Delhi- 110078.
2. Building comprised of : Basement (Parking), ground plus 04 upper floors.
3. Type of Occupancy : Educational
4. Type of Case : Renewal
5. Details of Previous NOC : F.6/DFS/MS/School/2022/SZ/381 dated 06.04.2022
6. Fire Safety directives letter No : F6/DFS/MS/BP/2013/263 dated 30.08.2013
7. Date of inspection : 09.06.2026
8. Name of Inspecting Officer : A.D.O. R.K. Yadav (DWK)
9. Name and designation of officers
From the building side : Sh. Surjan Singh
10. Year of Construction : 2003 & 2017
11. Applicant's letter No. : etl.mcdonline Application No. 52026052603164

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	Requirements Rule 35 (6)	Provided at site	Remarks MR/NMR
1.	Access to building			
	- Road width - Gate width - Width of internal road	12.0 m 4.5 m 6.0 m	Provided Provided Provided	M/R MR MR
2.	Number, Width, Type & Arrangement of Exits			
	a. Number of staircases			
	- Upper Floors - Basements	02 Nos. 04 Nos. + Ramp	02 Nos. 04 Nos. + Ramp	MR MR
	b. Width of staircases			
	- Upper Floor - Basements	1.5 m each 1.5 m each + Ramp	1.5 m each 1.5 m each +3.46 m Ramp	MR MR
	c. Protection of exits			
	- Fire check door - Pressurization	Required N/A	Provided N/A	MR N/A
	d. No. of continuous staircases to terrace	02	Provided	MR
	e. Width of Corridor	2.0 m	2.40 m	N/A
	f. Door Size	1.0 m	1.5 m (including frame)	MR
3.	Compartmentation			
	- Fire check door - Sealing of electrical shafts - Fire Rating of shaft door - Water Curtain - Fire Dampers	Required Required 02 Hours N/A N/A	Provided Sealed Provided N/A N/A	MR MR MR N/A N/A
4.	Smoke Management System			
	- Basements - Upper floors	30 ACPH 12 ACPH	Provided Natural ventilation provided	MR M/R
5.	Fire Extinguishers			
	- Total numbers - Types - IS marking	24 no's ABC/CO ₂ type ISI marked	Provided Provided Provided	MR MR MR
6.	First-Aid Hose Reels			
	Total numbers on each floor	02 Nos.		

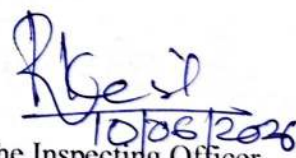
7.	Automatic fire detection and alarming system			
	• Type of detectors	N/A	N/A	N/A
	• Location of Main Panel	N/A	N/A	N/A
	• Location of Repeater Panel	N/A	N/A	N/A
	• Alternate source of power	N/A	N/A	N/A
	• Hooters' Location	N/A	N/A	N/A
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Provided	MR
10.	Automatic Sprinkler System			
	• Basement	Required	Provided	MR
	• Ground Floor	N/A	N/A	N/A
	• Sprinkler above false ceiling	N/A	N/A	N/A
11.	Internal Hydrants			
	• Size of riser/down-comer	100 mm	Provided	MR
	• Number of hydrants per floor	02 Nos.	Provided	MR
	• Hose Box	Required	Provided	MR
12.	Yard Hydrants			
	• Total number of hydrants	N/A	N/A	N/A
	• Hose Box	N/A	N/A	N/A
13.	Pumping Arrangements			
	• Ground Level			
	➤ Discharge of main Pump	N/A	N/A	N/A
	➤ Head of Main pump	N/A	N/A	N/A
	➤ Number of main pumps	N/A	N/A	N/A
	➤ Jockey Pump out put	N/A	N/A	N/A
	➤ Jockey pump head	N/A	N/A	N/A
	➤ Standby Pump out put	N/A	N/A	N/A
	➤ Standby Pump Head	N/A	N/A	N/A
	➤ Auto Starting/Manual Stopping	N/A	N/A	N/A
	➤ Pump House Access	N/A	N/A	N/A
	• Terrace level			
	➤ Discharge of pump	1620 LPM	Provided	MR
	➤ Head of the pump	40 m	Provided	MR
	➤ Power Supply	Required	Provided	MR
	➤ Auto Starting of pump	Required	Provided	MR
14.	Captive Water Storage for fire fighting			
	• Underground tank capacity	N/A	N/A	N/A
	➤ Draw-off connection	N/A	N/A	N/A
	➤ Fire service inlet	N/A	N/A	N/A
	➤ Access to tank	N/A	N/A	N/A
	• Overhead Tank capacity	55,000 ltrs	Provided	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
			No Lift	
	• Pressurization of Lift Shaft	Required	Provided	MR
	• Pressurization of Lift lobby	Required	Provided	MR
	• Communication In lift Car	Required	Provided	MR
	• Fireman's Grounding Switch	Required	Provided	MR
	• Lift Signage	Required	Provided	MR

	Standby power supply	Required	Provided	MR
18.	Refuge Area.			
	➤ Total Area	N/A	N/A	N/A
	➤ Location	N/A	N/A	N/A
19.	Fire Control Room			
	• Detector System Panel	N/A	N/A	N/A
	• Flow Switch Panel	N/A	N/A	N/A
	• PA System Panel	N/A	N/A	N/A
	• Battery backup	N/A	N/A	N/A
	• Building Floor Plans	N/A	N/A	N/A
20.	Special Fire Protection System for Protection of special Risks, if any:	Required	Co2 Fire extinguisher provided near elect. panel	MR

The fire protection systems provided in the building were tested, checked and found functional at the time of inspection. The shortcomings was issued by this department vide letter No. F.6/DFS/MS/School/2025/SZ/227 dated 16.04.2025 have been rectified.

Note: - As per affidavit submitted by school management (placed at C-69) that the basement of the school building is being used exclusively for parking purposes and not for any other activity. The parking facility is being used by staff and visitors, and all necessary safety precautions are being taken.

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules the Fire Safety Certificate issued vide letter No. F.6/DFS/MS/School/2022/SZ/381 dated 06.04.2022, is **recommended to be renewed** under rule 37, of the Delhi Fire Service Rules, 2010.


 Signature of the Inspecting Officer
 Name: - R.K. Yadav
 Designation: - ADO (DWK)

~~DO (SW)~~

 12/6/26
RAJINDER ATWAL
 Dy. Cfo (W2)

~~Cfo (W2)~~
~~Pr. Director~~


 12/06/2026


 18/06/26

Cfo to Issue.

~~Cfo (W2)~~


 19/06/26
 F-T. please.