

c/163

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: CONNAUGHT PLACE
NEW DELHI-110 001.

No. F.6/DFS/MS/School/2026/SZ/57

Dated: 13/05/2026

FIRE SAFETY CERTIFICATE

Certified that the M.D.H International School located at Plot No. 3, Pocket- 2, Sector- 6, Dwarka, New Delhi- 110075, comprised of basement (not in use), ground plus 04 upper floors, owned/occupied by Institute of Mahashay Chuni Lal Charitable Trust. Earlier, the school building was issued FSC by this department vide letter No. F6/DFS/MS/School/2025/SZ/831 dated 26/06/2025 for ground plus 03 upper floor only. The building was re-inspected by the officer concerned of this department on dated 29.04.2026 in the presence of Ms. Nandini Bidalia (Principal), and found that the school building have complied with the fire prevention and fire safety requirements in accordance with the fire prevention and fire safety requirements in accordance with Rule 33 of the Delhi Fire Service Rules, 2010 and that the building/ premises (ground plus four upper floors) is fit for occupancy class B "Educational Building" with effect from 13/05/2026 for a period of three years in accordance with the Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rules, 2010, printed below.

Issued on 13/05/2026 at New Delhi.


(A. K. Malik)
Chief Fire Officer
South Zone
9cu

Copy to: -

1. The Director of Education, Govt. of NCT of Delhi, Old Secretariat, New Delhi-110054.
2. The Principal, M.D.H International School located at Plot No. 3, Pocket- 2, Sector- 6, Dwarka, New Delhi- 110075.
3. The Executive Engineer (Bldg.), MCD, Civic Centre, New Delhi.

: - for information regarding use of basement.

Conditions for the validity of fire safety certificate: -

1. All the fire safety arrangements provided therein shall be maintained in good working condition at all times.
2. The means of escape shall be kept unlocked and unobstructed for unhindered evacuation of occupants in case of emergency.
3. Any loss of life or property due to non-functional fire safety measures shall be at the risk and responsibility of the management.
4. The trained staff should be available round the clock.
5. Any deviations w.r.t. construction shall be verified by the concerned building sanctioning agency.
6. The certificate may not be treated in any case for the regularization of the unauthorized construction, if any.
7. Presently basement is permanently closed.
8. The owner/occupier shall submit a declaration every year in the form 'K' provided in the first schedule of Delhi Fire Service Rules 2010, form is available on www.dfs.delhigovt.nic.in.
9. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in the Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry.

INSPECTION REPORT

1. Name & address of the building : M.D.H International School (An institute of Mahashya Chuni Lal Charitable Trust) Located at Plot No 3, Pocket - 2, Sector. 6, Dwarka, New Delhi - 110075.
2. Type of Occupancy : Educational Building
3. Building is comprised of : Basement, G+4 upper floors, Basement not use for any activity.
4. Type of Case : New Case/ addition/ alteration
5. Details of Previous FSC : F6/DFS/MS/School/2025/SZ/831 dt. 26/06/2025 (for G+3 UFs)
6. Fire Safety directives letter No : F6/DFS/MS/BP/2002/1659 dated 19/09/2002 & F6/DFS/MS/BP/2023/51 dated 21/02/2023 **(For B+G+4UFS)**
7. Date of inspection : 29.04.2026
8. Name of Inspecting Officer : A.D.O. R.K. Yadav
9. Name and designation of officers : Ms. Nandini Bidalia (Principal)
10. Year of Construction : 2002 & 2023
11. Applicant's letter No. : Nil, dated 28.04.2026

S. No.	Minimum Standards on fire prevention and fire safety U/R 33	Requirement as per directives letter dt. 21.02.2023	Provided at site	Remarks MR/NMR
1.	Access to building			
	- Road width - Gate width - Width of internal road	6.0 m 6.0 m 6.0 m	Provided Provided 6.0 m in three side, 5.77 to 6.0 m in 4 th side having dead face.	MR MR MR, Old Case
2.	Number, Width, Type & Arrangement of Exits			
	a. Number of staircases			
	- Upper Floors - Basements	02 nos. 02 nos.	03 nos. Provided	MR MR
	b. Width of staircases			
	- Upper Floor - Basements	1.5 m each 1.5 m & 1.2m	Provided Provided	MR MR
	c. Protection of exits			
	- Fire check door - Pressurization	Required NA	Provided NA	MR NA
	d. No. of continuous staircases to terrace	2 Nos.	Provided	MR
	e. Width of Corridor	1.5 m	Provided	MR
	f. Door Size	1.0 m & 1.2 m at 4 th floor	Provided	MR
3.	Compartmentation			
	- Fire check door - Sealing of electrical shafts - Fire Rating of shaft door - Water Curtain - Fire Dampers	Required Required N/A N/A N/A	Provided Sealed N/A N/A N/A	MR MR N/A N/A N/A
4.	Smoke Management System			
	- Basements - Upper floors	Required Required	Provided Natural ventilation provided	MR MR
5.	Fire Extinguishers			
	- Total numbers - Types - IS marking	25 no's ABC/CO ₂ type ISI marked	Provided Provided Provided	MR MR MR
6.	First-Aid Hose Reels			
	- Total numbers on each floor - Length of hose reel hose - Nozzle diameter	01 Nos. 30 m 5 mm	Provided Provided Provided	MR MR MR


7.	Automatic fire detection and alarming system			N/A
	• Type of detector	N/A	N/A	N/A
	• Location of Main Panel	N/A	N/A	N/A
	• Location of Repeater Panel	N/A	N/A	N/A
	• Alternate source of power	N/A	N/A	N/A
	• Batteries Location	N/A	N/A	MR
8.	NOTFA	Required	Provided	MR
9.	Public Address System	Required	Provided	
10.	Automatic Sprinkler System			MR
	• Basement	Required	Provided	N/A
	• Ground Floor	N/A	N/A	N/A
	• Sprinkler above false ceiling	N/A	N/A	
11.	Internal Hydrants			
	• Size of riser/down-comer	100 mm	Provided	MR
	• Number of hydrants per floor	01 nos.	Provided	MR
	• Hose Box	Required	Provided	MR
12.	Yard Hydrants			
	• Total number of hydrants	02 Nos.	Provided	MR
	• Hose Box	Required	Provided	MR
13.	Pumping Arrangements			
	• Ground Level			
	➤ Discharge of main Pump	N/A	N/A	N/A
	➤ Head of Main pump	N/A	N/A	N/A
	➤ Number of main pumps	N/A	N/A	N/A
	➤ Jockey Pump out put	N/A	N/A	N/A
	➤ Jockey pump head	N/A	N/A	N/A
	➤ Standby Pump out put	N/A	N/A	N/A
	➤ Standby Pump Head	N/A	N/A	N/A
	➤ Auto Starting/Manual Stopping	N/A	N/A	N/A
	➤ Pump House Access	N/A	N/A	N/A
	• Terrace level			
	➤ Discharge of pump	900 LPM	Provided	MR
	➤ Head of the pump	40 M	Provided	MR
	➤ Power Supply	Required	Provided	MR
	➤ Auto Starting of pump	Required	Provided	MR
14.	Captive Water Storage for fire-fighting			
	• Underground tank capacity	N/A	N/A	N/A
	➤ Draw-off connection	N/A	N/A	N/A
	➤ Fire service inlet	N/A	N/A	N/A
	➤ Access to tank	N/A	N/A	N/A
	• Overhead Tank capacity	25,000 ltrs.	25,000 ltrs	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			(No Lift)
	• Pressurization of Lift Shaft	N/A	N/A	N/A
	• Pressurization of Lift lobby	N/A	N/A	N/A
	• Communication In lift Car	N/A	N/A	N/A
	• Fireman's Grounding Switch	N/A	N/A	N/A
	• Lift Signage	N/A	N/A	N/A
17.	Standby power supply	Required	Provided	MR

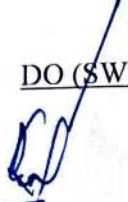
18.	Refuge Area.		N/A	N/A	N/A
		➤ Total Area ➤ Location	N/A	N/A	N/A
19.	Fire Control Room		N/A	N/A	N/A
		• Detector System Panel	N/A	N/A	N/A
		• Flow Switch Panel	Required	Provided	MR
		• PA System Panel	Required	Provided	MR
		• Battery backup	Required	Provided	MR
		• Building Floor Plans	Required	Co2 fire extinguisher provided near electric panel	MR
20.	Special Fire Protection System for Protection of special Risks, if any:				

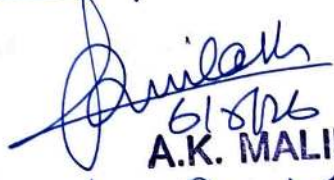
The fire protection systems provided in the building were tested, checked and found functional at the time of inspection. The shortcomings was issued by this department vide letter No. F.6/DFS/MS/SZ/2026/82 dated 23.01.2026 have been rectified.

Note: - Earlier, this department issued FSC vide letter No. F6/DFS/MS/School/2025/SZ/831 dated 26/06/2025 for ground plus 03 upper floor only. Basement of the building is not used for any activity. **The internal road having width of 6.0 m provided in three side and 5.77 to 6.0 m provided in rear side of building having dead face** and all corridors or windows are opening in front and other side of the building (Affidavit/ undertaking placed at C-159).

Keeping in view the compliance of the minimum standards on fire prevention and fire safety required under the rules **it is recommended to grant Fire Safety Certificate** under Rule 35 of the Delhi Fire Service Rule 2010.


Signature of the Inspecting Officer
Name: - R.K. Yadav
Designation: - ADO (DWK)

DO (SW)

2/5
RAJINDER ATWAL
C.S. (CS)


6/8/26
A.K. MALIK
Principal Director

CS to Secy

2/8/26


01/8/26
A.K. MALIK
CS - ON leave
SW