



C-32



**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI**  
**HEADQUARTERS: DELHI FIRE SERVICE: CANNAUGHT PLACE**  
**NEW DELHI- 110 001**

No.F6/DFS/MS/School/2025/NDZ/ 1060

Dated: 25/08/2025

**FIRE SAFETY CERTIFICATE**

Certified that the Oriental Public School located at V-497, Arvind Nagar, Ghonda, Delhi-110053, comprised of Ground plus three upper floors but school is running Ground plus two upper floors only (3<sup>rd</sup> floor sealed and not in use) owned/occupied by Oriental Public School was issued FSC vide letter No. F.6/DFS/MS/School/2017/NDZ/670 dated 09/05/17. The school building was re-inspected by the officer concerned of this department on 08/08/2025 in the presence of Mrs. Kusum Lata (Principal) and observed that all the fire prevention and fire safety arrangements provided in the premises found in good working condition. The premises have therefore deemed complied with rule 33 of Delhi Fire Service Rules 2010 and that **the building is fit for occupancy class "Educational" (Group-B)(Ground plus two upper floors only)** with effect from 25/08/2025 for a period of three years in accordance with rule 36 unless renewal under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the DFS rules, 2010.

Issued on.....25/08/2025.....at New Delhi by.

  
25/08/2025  
(VIRENDRA SINGH)  
CHIEF FIRE OFFICER

To,

1. The Principal, Oriental Public School at V-497, Arvind Nagar, Ghonda, Delhi-110053
2. The Dy. Director of Education, B-Block, Yamuna Vihar, Delhi-110053

**Conditions for the validity of Fire Safety Certificate**

1. FSC is valid for ground plus two uppers only. Third floor which is sealed may not be used for any purpose failing which FSC should be treated null and void.
2. All the means of escape shall be kept free of all type of obstruction all the time.
3. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
4. All the firefighting equipment shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
5. Any deviation, with regards to construction, ventilation, occupancy, electric installation etc. may be got verified from the concerned authorities.
6. This Fire Safety Certificate may not be treated in any case for regularizations of unauthorized construction / unauthorized use of land if any.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in)
8. The owner / occupier shall apply for renewal of this Fire Safety Certificate of the Director in Form 'J' [sub rule (1) of rule (37)] along with a copy of this Certificate, Six Months prior to its expiry.

## INSPECTION REPORT

1. Name & address of the building : Oriental Public School  
V-497, Arvind Nagar, Ghonda, Delhi-110053
2. Building is comprised of : Ground Plus three upper floors  
school is running ground plus two upper floors only (3<sup>rd</sup> floor sealed)
3. Type of Occupancy : Educational
4. Type of Case : **Renewal**
5. Details of Previous NOC letter : F.6/DFS/MS/School/2017/NDZ/670 dated 09/05/17
6. Fire Safety direction letter No : NBC Part IV
7. Date of Inspection : 08/08/2025
8. Name of the Inspecting officers : ADO (Shd.) Deepak Kumar
9. Name and designation of Officer from the building side : Mrs. Kusum Lata (Principal)
10. Year of Construction : 1993
11. Applicant's letter No : [educatin.orientalpublicschool@gmail.com](mailto:educatin.orientalpublicschool@gmail.com)

Dated- 09/07/2025

Sr. No	Minimum Standards on fire prevention and fire safety U/R33	NBC Part IV Requirement	Provided at Site	Remarks MR/NMR
01	Access to building.			
	• Road width	06 mtr.	06 mtr.	MR
	• Gate width	N/A	N/A	N/A
	• Width of internal road	N/A	N/A	N/A
02	Number, Width, Type and Arrangement of Exits.			
	a. Number of Staircases			
	• Upper Floor	01 nos.	01 nos.	MR
	• Basement	N/A	N/A.	N/A
	B. Width of Staircases			
	• Upper Floor	1.50 mtr	1.50 mtr	MR
	• Basement	N/A	N/A.	N/A
	c. Protection of exits			
	• Fire check door	N/A	N/A	N/A
	• Pressurization	N/A	N/A	N/A
	d. No. of continuous staircases to terrace	01 nos.	01 nos.	MR
	e. Width of Corridor	1.50 mtr	1.50 mtr	MR
	f. Door Size	01 mtr	01 mtr	MR
03	Compartmentation.			
	• Fire check door	N/A	N/A	N/A
	• Sealing of electrical shafts	N/A	N/A	N/A
	• Fire rating of shaft door	N/A	N/A	N/A
	• Water curtain	N/A	N/A	N/A
	• Fire Dampers	N/A	N/A	N/A
04	Smoke Management System.			
	• Basement	N/A	N/A	N/A
	• Upper floor	N/A	N/A	N/A
05.	Fire Extinguishers.			
	• Total numbers	06 nos.	06 nos.	MR
	• Types	ABC /CO <sub>2</sub>	ABC /CO <sub>2</sub>	MR
	• IS marking	ISI marked	ISI marked	MR



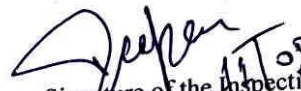
06	First-aid-Hose Reels.			
	• Total numbers on each floor	01 nos	01 nos	MR
	• Length of hose reel hose	30 m	30 m	MR
	• Nozzle diameter	05 m	05 m	MR
07	Automatic fire detection and alarming system.			
	• Type of detectors	N/A	N/A	N/A
	• Location of main panel	N/A	N/A	N/A
	• Location of repeater panel	N/A	N/A	N/A
	• Alternate source of power	N/A	N/A	N/A
	• Hooter's location	N/A	N/A	N/A
08	MOEFA	N/A	N/A	N/A
09	Public address System.	N/A	N/A	N/A
10	Automatic Sprinkler System.			
	• Basement	N/A	N/A	N/A
	• upper floor	N/A	N/A	N/A
	• sprinkler above false ceiling	N/A	N/A	N/A
11	Internal Hydrants			
	• size of riser/down-comer	N/A	N/A	N/A
	• Number of hydrants per floor	N/A	N/A	N/A
	• Hose Box	N/A	N/A	N/A
12	Yard Hydrants.			
	• Total number of hydrants	N/A	N/A	N/A
	• Hose Box	N/A	N/A	N/A
13	Pumping Arrangements.			
	➤ Ground Level	N/A	N/A	N/A
	• Discharge of main Pump	N/A	N/A	N/A
	• Head of Main Pump	N/A	N/A	N/A
	• Number of main pumps	N/A	N/A	N/A
	• Jockey pump out put	N/A	N/A	N/A
	• Jockey pump head	N/A	N/A	N/A
	• Standby pump out put	N/A	N/A	N/A
	• Standby pump Head	N/A	N/A	N/A
	• Auto Starting /Manual stopping	N/A	N/A	N/A
	• Pump House Access	N/A	N/A	N/A
	➤ Terrace Level			
	• Discharge of pump	450 LPM	450 LPM	MR
	• Head of the Pump	40 mtr	40 mtr	MR
	• Power supply	Required	Provided	MR
	• Auto Starting of pump	Required	Provided	MR
14	Captive Water Storage for Fire Fighting.			
	• Underground tank capacity	N/A	N/A	N/A
	• Draw-off connection	N/A	N/A	N/A
	• Fire service inlet	N/A	N/A	N/A
	• Access to tank	N/A	N/A	N/A
	• Overhead Tank capacity	10,000 Ltrs	10,000 Ltrs	MR
		N/A	N/A	N/A
15	Exit Signage.			
16	Provision of Lifts.			
	• Pressurization of Lift Shaft	N/A	N/A	N/A
	• Pressurization of Lift lobby	N/A	N/A	N/A
	• Communication in lift car	N/A	N/A	N/A
	• Firemen's grounding switch	N/A	N/A	N/A
	• Lift Signage	N/A	N/A	N/A

17	Standby power supply	N/A	N/A	N/A
18	Refuge Area.			
	• Total area	N/A	N/A	N/A
	• Location	N/A	N/A	N/A
19	Fire Control Room			
	• Detector system panel	N/A	N/A	N/A
	• Flow switch panel	N/A	N/A	N/A
	• PA system panel	N/A	N/A	N/A
	• Battery backup	N/A	N/A	N/A
	• Building Floor Plans	N/A	N/A	N/A
20	Special Fire Protection systems for protection of special Risks, if any:	N/A	N/A	N/A

**Note:-** The school management has been submitted undertaking that the third floor is sealed (Photo attached) and not being used for school and any purpose.


The fire protection systems provided in the building were tested/checked and found functional at the time of inspection.

Keeping in view the deemed compliance of the minimum standards on fire prevention and fire safety required under the Rules. The FSC issued vide letter No. F.6/DFS/MS/School/2017/NDZ/670 dated 09/05/17 renewal under rule 37 of the Delhi Fire Service Rule, 2010 is recommended.

  
Signature of the Inspecting Officer  
Name : - Deepak Kumar  
Designation : - A.D.O (Shahdara)

~~DO/ED~~   
11/08/2025

By CFO/NDZ   
13/08/25

CFO/  
  
16/8/2025

Principal Director


CF to Gm

  
18/08/25

A.D.O (shahdara)

CF/NDZ  


Sir, F.T. letter is put up for your kind  
Signature pl

CFO/  
  
22/8/2025

  
21/08/2025

B MS