

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS, DELHI FIRE SERVICE, NEW DELHI - 110001


No.F6/DFS/MS/Hosp. /SZ/2026/ 76

Dated 04/05/2026

FIRE SAFETY CERTIFICATE

Certified that **The Woman Hones Hospital Pvt. Ltd.** at R-1 Nehru Enclave , Outer Ring Road, New Delhi, comprised of single basement, ground and three upper floor, has complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and verified by the officer concerned of this department on 02/05/2026 in the presence of Sh. Harjeet Singh , Admin Head and found that the premises is fit for occupancy class C – **Institutional Building** with effect from 04/05/2026-----for period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules 2010, printed below.

Issued 04/05/2026-----at New Delhi by.


415726
(A.K. Malik)
Chief Fire Officer


Copy to:-

1. The Commissioner, MCD, Civic Centre , New Delhi : to verify the covered area & height and the occupancy as detailed above and deviation in construction if any.
2. The Medical Superintendent nursing home , Directorate General of Health services (nursing home) ,3rd floor Delhi Government Dispensary Building , S-1 School Block Shakarpur , Delhi -11092 .
3. Sh. Gourav Singh , COO, The Woman Hones Hospital Pvt. Ltd. at R-1 Nehru Enclave , Outer Ring Road, New Delhi.

Condition for the validity of fire safety certificate.

1. All the fire safety arrangements provided therein shall be maintained in good working conditions at all times.
2. Any loss of life or property due to nonfunctional fire safety measures shall be at the responsibility of the management.
3. The trained firefighting staff should be available round the clock.
4. The compliance w.r.t. deviation in construction, set back area, lift , electrical installation etc. shall be verified by the authority concerned .
5. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
6. The basement shall be used strictly as per UBBL -2016.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
8. The means of escape such as staircase , corridor , passage way , exits shall be kept unobstructed / unlocked for unhindered evacuation in case of an emergency.
9. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (I) of rule 37] along with a copy of this Certificate, six month prior to its expiry".

INSPECTION REPORT

1. Name & address of the building: The Woman Honest Hospital Pvt Ltd. , at R-1 Nehru Enclave, Outer ring road Kalka ji . New Delhi.
2. Type of occupancy Class -C" Institutional (Hospital)- B, GF and 03 Upper floors.
3. Type of case:- New
4. Details of previous FSC nil
5. Fire safety directives No. F.6/DF/MS/BP/2026/132 dated 30/04/2026
6. Date of inspection:- 02.05.2026
7. Name of the inspecting officer Sh.Sarabjeet Singh (ADO/BCP)
8. Name & designation of officer Mr. Harjeet singh , Admin Head
9. Year of construction 2026
10. Applicant's letter No letter no. Nil & dated 30.04.2026 & DFS out diary no. 889.

S.No.	Minimum Standards on fire Prevention and fire safety U/R 33	Requirements	Provided at site	Remarks MR/NMR
1.	Access to Building			
	1) Road width	36 mtr.	36.57 mtr.	MR
	2) Gate width	N/A	N/A	N/A
	3) Width of internal road	N/A	N/A	N/A
2.	Number, Width Type & Arrangement of Exits			
	A. Number of staircases			
	1. Upper floors	0 Nos.	Provided	MR
	2. Basements	0 Nos	Provided	MR
	B. Width of staircase			
	1. Upper floors	02 m & 1.5 m	Provided	MR
	2. Basements	02 m & 1.5 m	Provided	MR
	C. Protection of exits			
	1. Fire check door	Required	Provided	MR
	2. Pressurization/ naturally	Required	Provided	MR
	D. No. of continuous staircase to terrace	02 No	Provided	MR
	E. Width of corridor	2.4 mtr.	Provided	MR
	F. Door size	2 Mtr., 1.5 mtr. & 1.25m	Provided	MR
3.	Compartmentation			
	1) Fire check door	Required	Provided	MR
	2) Sealing of electrical shafts	Required	Provided	MR
	3) Fire rating of shaft door	Required	Provided	MR
	4) Water curtain	N/A	N/A	N/A
	5) Fire Dampers	N/A	N/A	N/A
4.	Smoke Management System			
	1) Basements	Required	Provided	MR
	2) Upper floors	Required	Provided	MR
5.	Fire Extinguishers			
	1) Total numbers	16 nos nos.	Provided	MR

	2) Types	ABC & CO2	Provided	MR
	3) ISI marking	Required	Provided	MR
6.	First-Aid Hose Reel			
	1) Total number of each floor	01	02 nos	MR
	2) Length of hose reel hose	30 m	Provided	MR
	3) Nozzle diameter	5 mm	Provided	MR
7.	Automatic Fire Detection & Alarming System			
	1) Type of detectors	Smoke	Provided	MR
	2) Location of main panel	Gr. Floor	Provided	MR
	3) Location of repeater panel	N/A	N/A	N/A
	4) Alternate source of power	Required	Provided	MR
	5) Hooter's Location	Each floor	Provided	MR
8.	MOEFA	Required	Provided	MR
9.	Public Address System	N/A	N/A	N/A
10.	Automatic Sprinkler System			
	1) Basement	Required	Provided	MR
	2) Upper floors	Required	Provided	MR
	3) Sprinkler above false ceiling	N/A	N/A	N/A
11.	Internal Hydrants			
	1) Size of riser	100 MM	Provided	MR
	2) Number of hydrants per floor	01	02 nos	MR
	3) Hose box each floor	01	02 nos	MR
12.	Yard Hydrants			
	1) Total number of hydrants	N/A	N/A	N/A
	2) Hose box	N/A	N/A	N/A
13.	Pumping Arrangement			
	1) Ground level			
	a) Discharge of main pump	1620 LPM	Provided	MR
	b) Head of main pump	55 mtr.	Provided	MR
	c) Number of main pump	01	Provided	MR
	d) Jockey pump out put	180 LPM	Provided	MR
	e) Jockey pump head	55 mtr.	Provided	MR
	f) Stand by pump output	1620 LPM	Provided	MR
	g) Stand by pump head	55 mtr.	Provided	MR
	h) Auto starting/Manual stopping	Required	Provided	MR
	2) Terrace level			
	a) Discharge of pump	N/A	N/A	N/A
	b) Head of pump	N/A	N/A	N/A
	c) Power supply	N/A	N/A	N/A
	d) Auto starting of pump	N/A	N/A	N/A
14.	Captive Water Storage for Fire Fighting			
	1) Under ground tank capacity	75,000 ltr.	Provided	MR
	a) Draw-off connection	Required	Provided	MR
	b) Fire service inlet	Required	Provided	MR
	c) Access to tank	Required	Provided	MR
	d) Over head tank capacity	10,000 Ltrs.	10,000 Ltrs.	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			

N/L

	a) Pressurization of lift shaft	Required	Provided	MR
	b) Pressurization /naturally of lift lobby	Required	Provided	MR
	c) Communication in lift car	Required	Provided	MR
	d) Fireman's switch	Required	Provided	MR
	e) Lift signage	Required	Provided	MR
17.	Stand by Power Supply	Required	Provided	MR
18.	Refuge Area	N/A	N/A	N/A
	Total area location	N/A	N/A	N/A
19.	Fire Control Room	N/A	N/A	N/A
	a) Detector system panel	N/A	N/A	N/A
	b) Flow switch panel	N/A	N/A	N/A
	c) PA system panel	N/A	N/A	N/A
	d) Battery backup	N/A	N/A	N/A
	e) Building floor plan	N/A	N/A	N/A
20.	Special Fire Protection System for Protection of special Risk, if any:			MR

The fire protection systems provided in the building were randomly tested, checked and found functional at the time of inspection.


In view of the substantial compliance minimum standards of fire prevention and fire safety measures as required under the rules. it is recommended to issue FSC to said hospital. Accordingly, DFA is prepared and put up for kind perusal and approval.

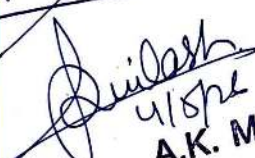
Signature of the Inspecting Officer

Name :- Sarbjeet Singh
Designation :- ADO (BCP)

DO/SD


4/5/26
Ravinder Singh


4/5/26
A.K. MALIK


4/5/26
A.K. MALIK

Principal Director

Cfo to 


04/05/26


4/5/26
A.K. MALIK


04/05/26


04/05/26